


Not to scale

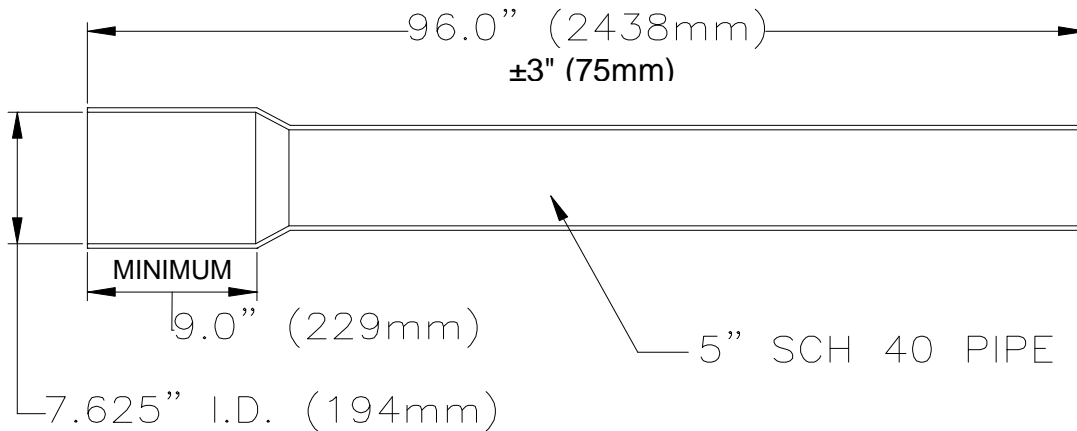

MANUFACTURING DETAILS:

1. Use the I.D. tester to check a full crate of pipe before opening a crate. The I.D. needs to be checked to minimize the risk that a pipe will explode or get stuck on the mold while expanding it. Do this for your safety.
2. Heat 17" of the pipe in glycol for approximately 25 seconds.
3. The sockets must be trimmed on the roller saw or ground straight on the facing grinder and the edges scraped clean.

PACKAGING DETAILS:

Neatly place a product sticker on the exterior of each socket. Stagger the hubs end for end.

25 Pcs per crate.

Top and Bottom boards: qty. 6 @ 31" Long

Side Boards: qty. 4 @ 27¾" Long

Strapping Length: qty. 2 @ 140" Long

Wash the inside and outside of the pipe. Be sure to wash out all the grinding dust from inside the sockets. Wrap the crate in white polyethylene plastic. Place a product sticker on the right hand side of the crate on the front and back.